### PROBE INSERTION GUIDELINE DRAWING<sup>1</sup>


Choose the longest straight-run section of pipe available to allow a uniform, well-developed flow profile. Allow for a *minimum* of 15 pipe diameters of straight run upstream, and 5 diameters downstream, depending on the conditions. See chart on page 11. Note, obstructions such as valves, blowers expanders and PVC and HDPE pipes will require additional straight run (contact factory for assistance). Avoid, if possible, installations immediately downstream of bends, fans, nozzles, heaters and especially valves, or anything else installed in the line that may cause nonuniform flow profiles and swirls. Otherwise signal output errors could result, unless significantly more straight run is provided, or in the absence of sufficient straight run, Flow Conditioners (page 13) are installed (contact Sage for assistance if needed). Refer to page 13 to see the benefits of incorporating Flow Conditioners.

Insertion styles are available through Sage Metering, Inc. with a standard 1/2" OD probe support assembly; 3/4" is also available. Standard probe lengths are 6", 12", 15", 18", 24", 30", 36" and 48". A common method of mounting the probe assembly through a pipe wall or duct (if ambient air) is with a compression fitting (STCFOS). A Sage valve assembly (SVAOS)

Sage insertion style flow meters can be assembled and calibrated for use in virtually any size pipe or duct (as small as 1"). Sage insertion flow meters include a probe assembly that supports the sensing element (a self-heated flow sensor and a temperature/reference sensor); a sensor drive circuit; microprocessor meter board, and transmitter enclosure. The probe assembly must be inserted into the correct position in the process gas flow conduit to allow the gas to flow through the sensor "window" across the sensor element. The "sensing point" or active part of the sensor (0.5" from the end of the probe) should be positioned as per the drawing below and the Installation Depth Chart on page 15.

# **Installation Depth**

The center of the pipe (assuming a well developed turbulent flow profile) is fairly flat, and easy to locate. See "Installation Depth Chart" on next page to determine proper insertion depth.

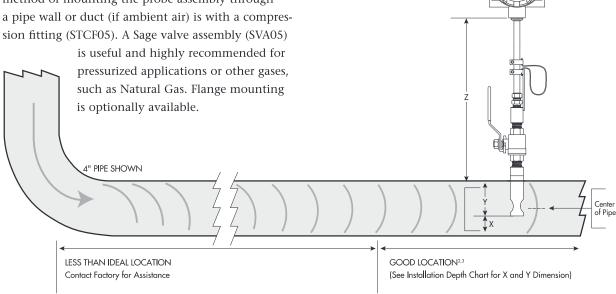

- 1. SIP Industrial Meter shown in drawing. Note, probe is not bi-directional.
- Probe should be inserted per Installation Depth Chart (see following page), so sensors are in the center of the pipe.
- The portion of the probe that remains outside of the pipe, is simply the factory ordered probe length (i.e. "-15" = 15 inches) minus the "Y" dimension.

User Manual SAGE METERING, INC.


# INSTALLATION DEPTH CHART Methods for Probe Insertion to Pipe Center

## METHOD 1

Using charts below, select pipe size (column 1), determine X. Insert probe until the end touches the bottom of the pipe (ID), mark probe as it exits top of fitting. Lift probe distance "X" and tighten compression fitting.

### METHOD 2

Using charts below<sup>1</sup>, select pipe size (column 1), determine Y. Subtract Y from the factory supplied probe length. That difference Z (see drawing on page 14) should be outside of the pipe, and is measured from the bottom of the enclosure of the probe weld to pipe OD.

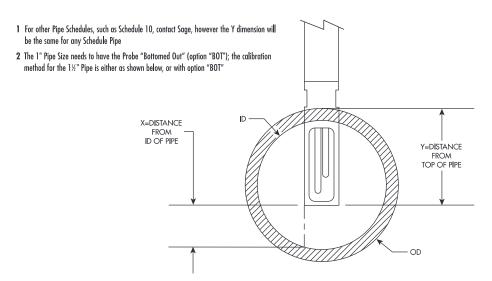

SCHEDULE 40 PIPE <sup>2</sup>								
PIPE SIZE	OD	ID	Х	Υ	PIPE AREA			
1"	C 0	N S U	LT F.	A C T O	R Y			
1.5"	1.900	1.610	.20"	1.56"	0.0141			
2"	2.375	2.067	.40"	1.82"	0.0233			
2.5"	2.875	2.469	.60"	2.07"	0.0332			
3"	3.500	3.068	.90"	2.38"	0.0513			
4"	4.500	4.026	1.40"	2.86"	0.0884			
6"	6.625	6.065	2.40"	3.95"	0.2006			
8"	8.625	7.981	3.40"	4.90"	0.3474			
10"	10.750	10.020	4.40"	6.00"	0.5476			
12"	12.750	11.938	5.50"	7.00"	0.7773			
14"	14.000	13.124	6.00"	7.50"	0.9394			
16"	16.000	15.000	7.00"	8.60"	1.2272			
18"	18.000	16.876	8.00"	9.60"	1.5533			
24"	24.000	22.625	10.75"	12.60"	2.7919			

SCHEDULE 80 PIPE <sup>2</sup>								
PIPE SIZE	OD	ID	X	Υ	PIPE AREA			
1"	C 0	N S U	LT F.	A C T 0	R Y			
1.5"	1.900	1.500	.15"	1.56"	0.0123			
2"	2.375	1.939	.35"	1.82"	0.0205			
2.5"	2.875	2.323	.55"	2.07"	0.0294			
3"	3.500	2.900	.80"	2.38"	0.0459			
4"	4.500	3.826	1.30"	2.86"	0.0798			
6"	6.625	5.761	2.25"	3.95"	0.1810			
8"	8.625	7.625	3.25"	4.90"	0.3171			
10"	10.750	9.750	4.25"	6.00"	0.5185			
12"	12.750	11.374	5.13"	7.00"	0.7056			
14"	14.000	12.500	5.70"	7.50"	0.8522			
16"	16.000	14.312	6.60"	8.60"	1.1172			
18"	18.000	16.124	7.50"	9.60"	1.4180			
24"	24.000	21.562	10.25"	12.60"	2.5357			